

GROUP 4 MECHATRONICS SYSTEM

1. ALL ACTUATORS SPEED ARE SLOW


Boom, Arm, Bucket, Swing and travel speed are slow, but engine speed is good.

Spec : H-mode 2090 ± 50rpm


S-mode 1950 ± 50rpm

Before carrying out below procedure, check all the related connectors are properly inserted.

1) INSPECTION PROCEDURE

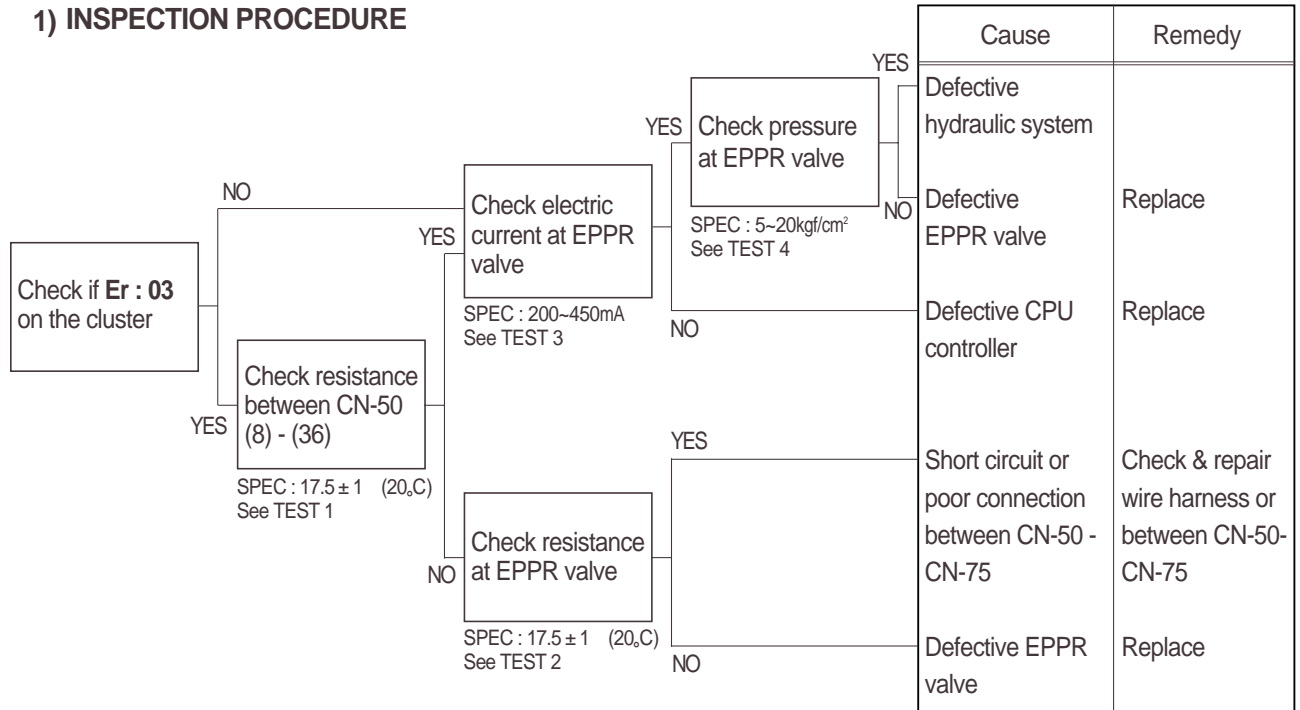

Wiring diagram

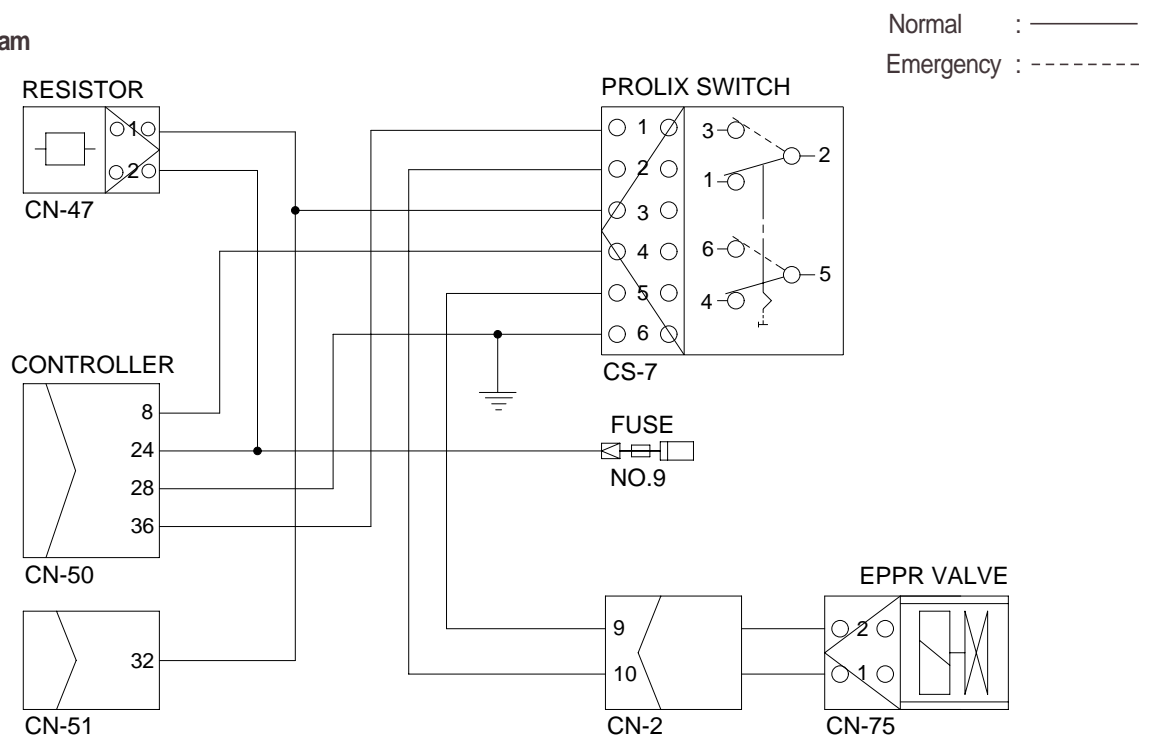


2) TEST PROCEDURE

- (1) **Test 1** : Check resistance at connector CN-50(8)-(36).

Starting key OFF.

Disconnect connector CN-50.

Check resistance between pin and at connector CN-50(8)-(36).

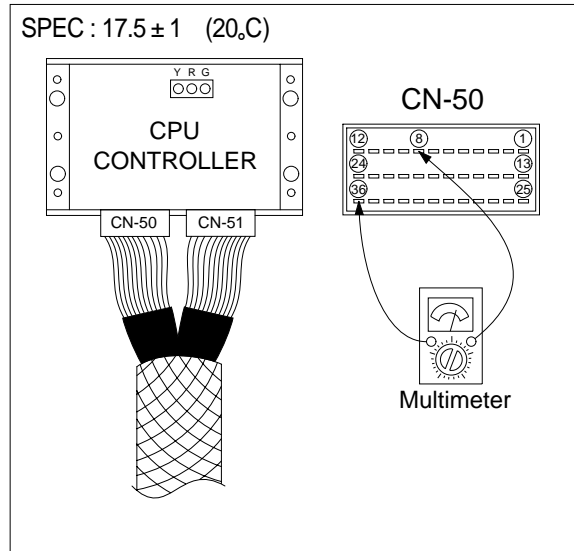


- (2) **Test 2** : Check resistance at connector CN-75.

Starting key OFF.

Disconnect connector CN-75 from EPPR valve at main hydraulic pump.

Check resistance between 2 lines as figure.

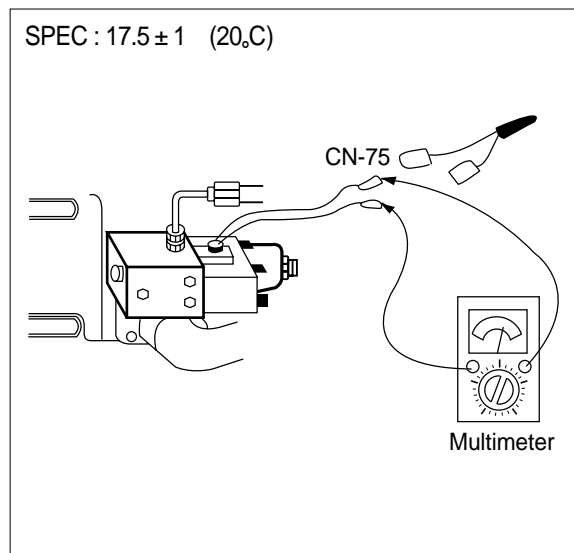

- (3) **Test 3** : Check electric current at EPPR valve.


Install multimeter as figure.

Start engine.

Set the accel dial at "10"(MAX)

Set S-mode and cancel auto decel mode.

If tachometer show approx 1950 ± 50 rpm,
 1850 ± 50 rpm(TIER II) check electric current.

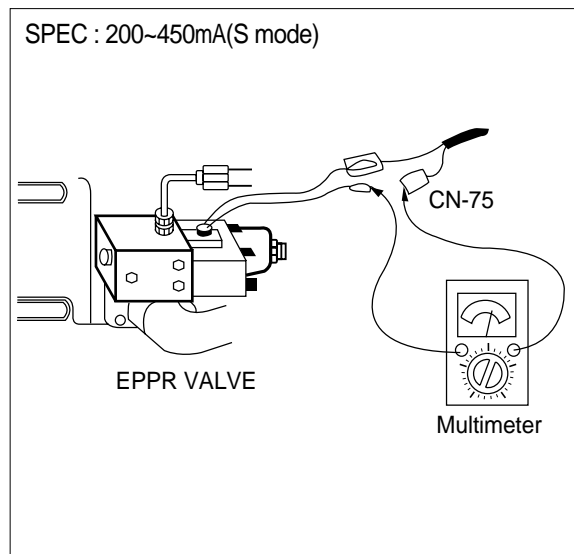

(2) **Test 4** : Check pressure at EPPR valve.
Remove plug and connect pressure gauge as figure.

- Gauge capacity : 0 to 40~50kgf/cm²
(0 to 570~710psi)

Start engine.

Set the accel dial at "10"(Max).


Set S-mode and cancel auto decel mode.

If tachometer show approx 1950 ± 50rpm,
1850 ± 50rpm(TIER II) check pressure.

If pressure is not correct, adjust it.

After adjust, test the machine.


SPEC : 5~20kgf/cm²(70~280psi)

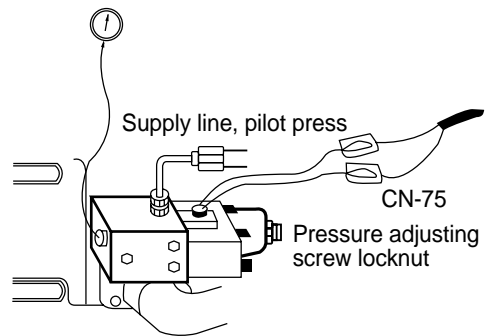


2. ENGINE SPEED IS SLOW AT ALL MODE

Before carrying out below procedure, check all the related connectors are properly inserted.

1) INSPECTION PROCEDURE

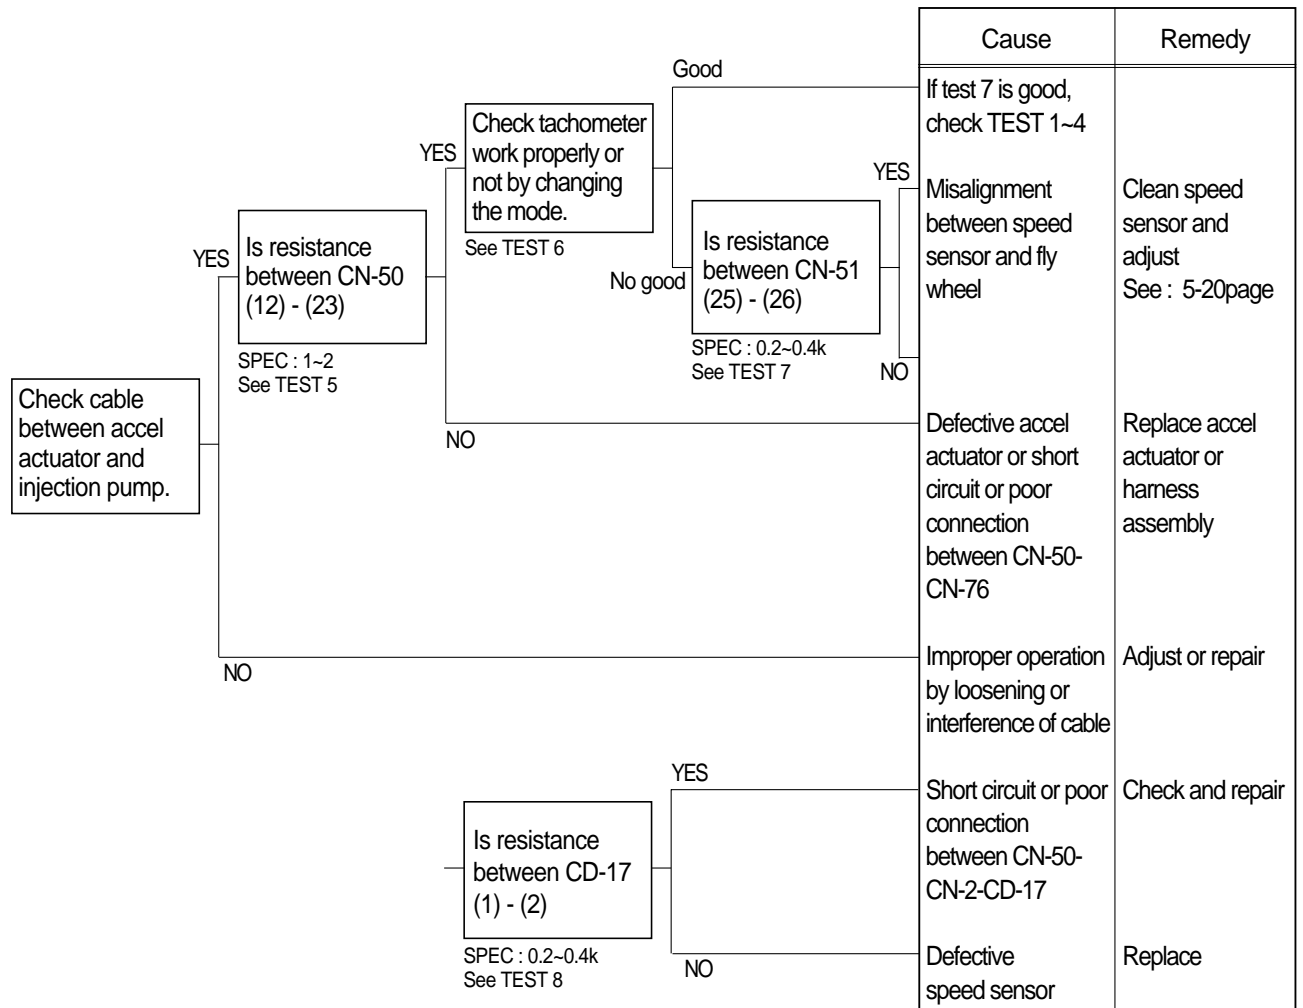


Wiring diagram

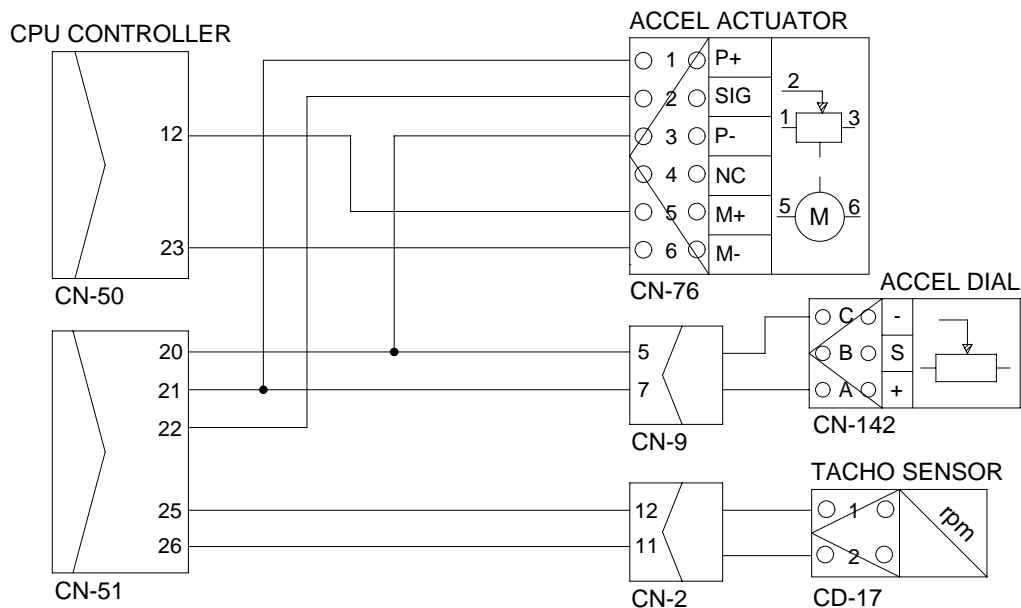

2) TEST PROCEDURE

- (1) **Test 5** : Check resistance between CN-50 (12)-(23).
Starting key OFF.
Disconnect connector CN-50 from CPU controller.
Check resistance as figure.

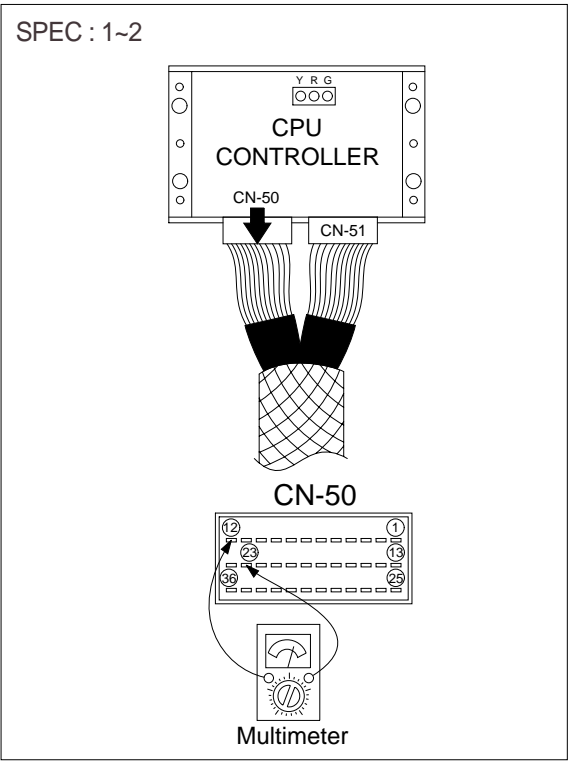


- (2) **Test 6** : Check tachometer(Work properly or not)
Start engine.
Check tachometer reading.

Unit : rpm

Spec		Remark
H-mode	2050 ± 50	Check rpm after cancel the Auto decel mode.
S-mode	1950 ± 50	

- (3) **Test 7** : Check resistance between CN-51 (25) and CN-51(26).
Starting key OFF.
Disconnect connector CN-51 from CPU controller.
Check resistance as figure.

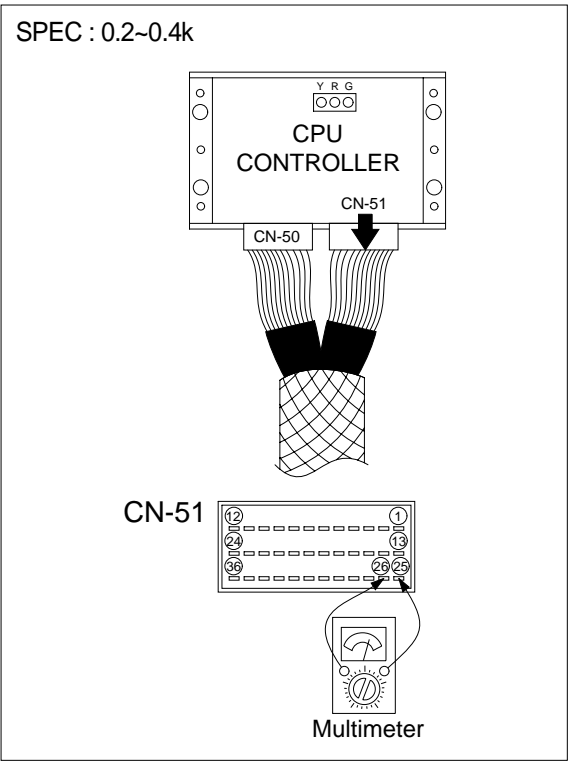


(4) **Test 8** : Check resistance at speed sensor.

Starting key OFF.

Disconnect connector CD-17 of speed sensor at engine flywheel housing.


Check resistance as figure.

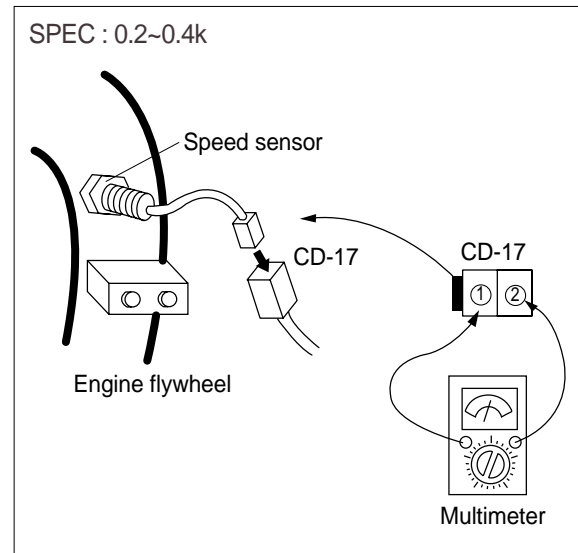


3. ENGINE STALL

Before carrying out below procedure, check all the related connectors are properly inserted.

1) INSPECTION PROCEDURE

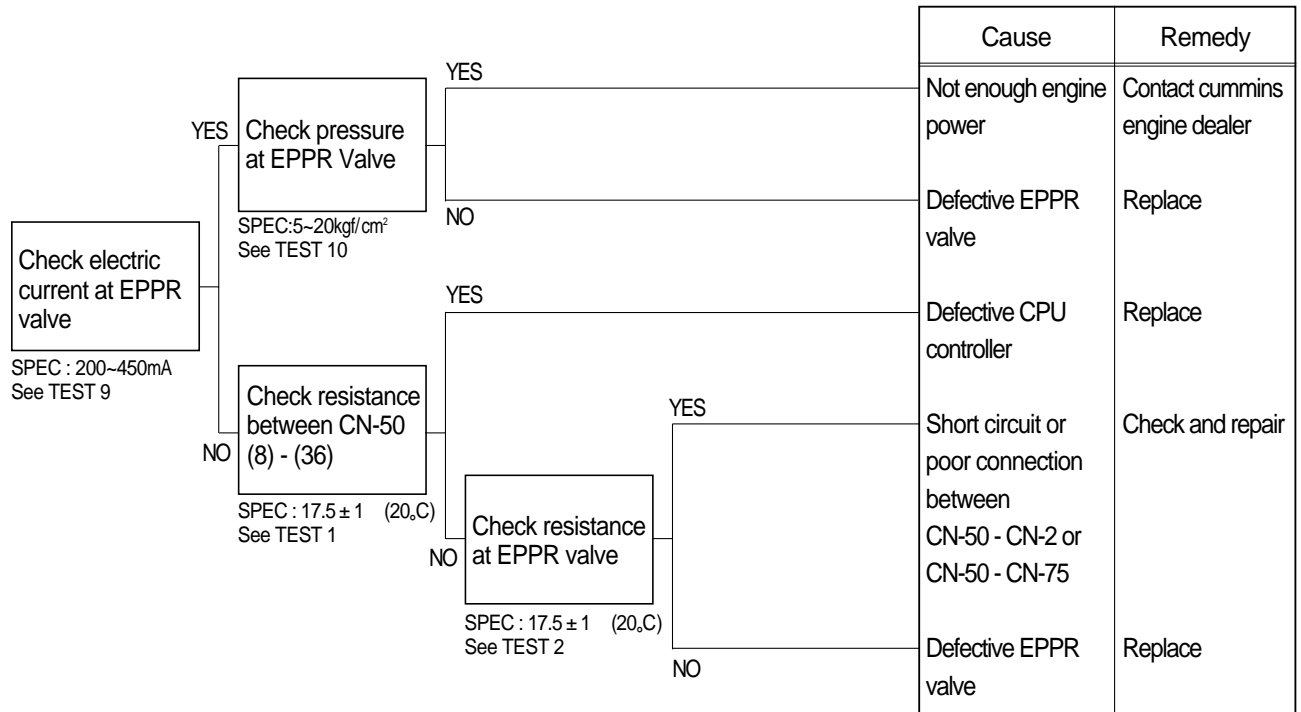

Wiring diagram

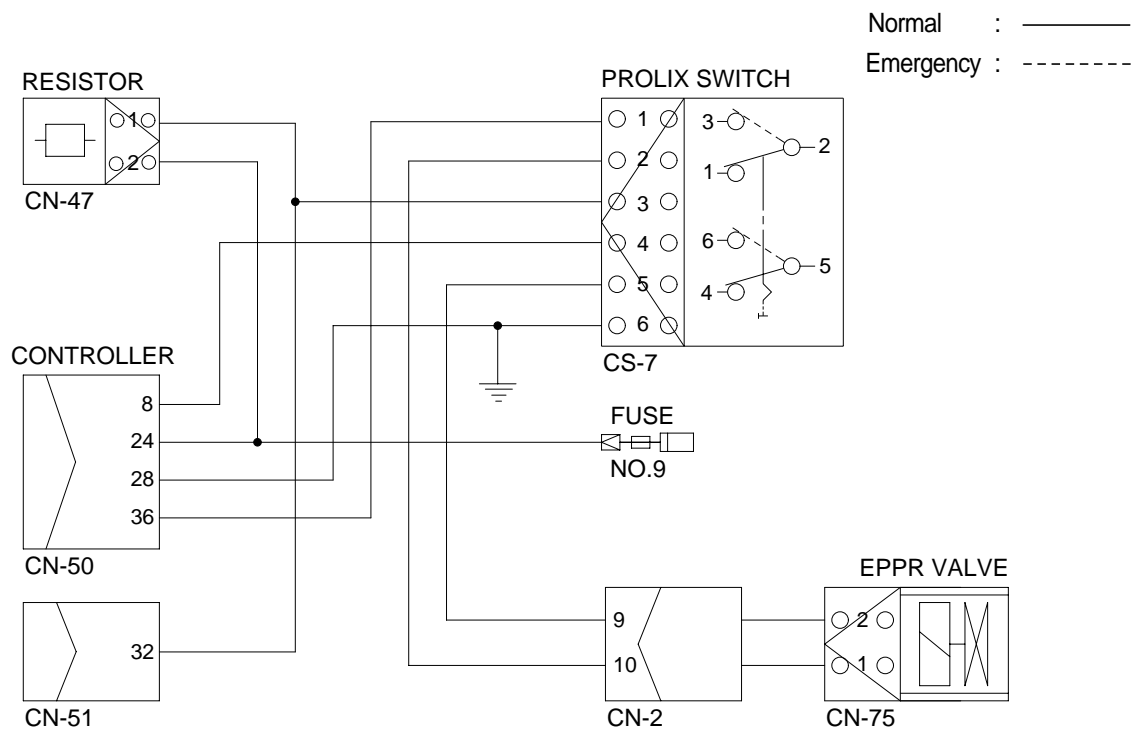

2) TEST PROCEDURE

(1) **Test 9** : Check electric current at EPPR valve at S-mode


Install multimeter as figure.

Start engine.

Set the accel dial at "10"(max)

Set S-mode with 1950 ± 50 rpm.

Check electric current.

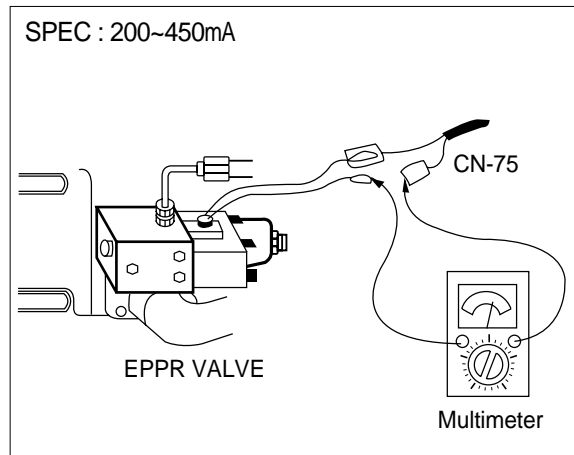

(2) **Test 10** : Check pressure at EPPR valve at S-mode

Connect pressure gauge at EPPR valve.

Start engine.


Set the accel dial at "10"(max)

Set S-mode with 1950 ± 50 rpm.

Operate bucket lever completely push or pull.

Hold arm lever at the end of stroke.


Check pressure at relief position.

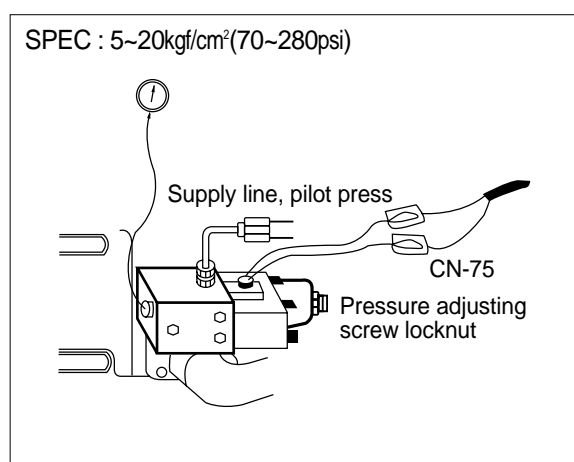


4. MALFUNCTION OF CLUSTER OR MODE SELECTION SYSTEM

Before carrying out below procedure, check all the related connectors are properly inserted.

1) INSPECTION PROCEDURE

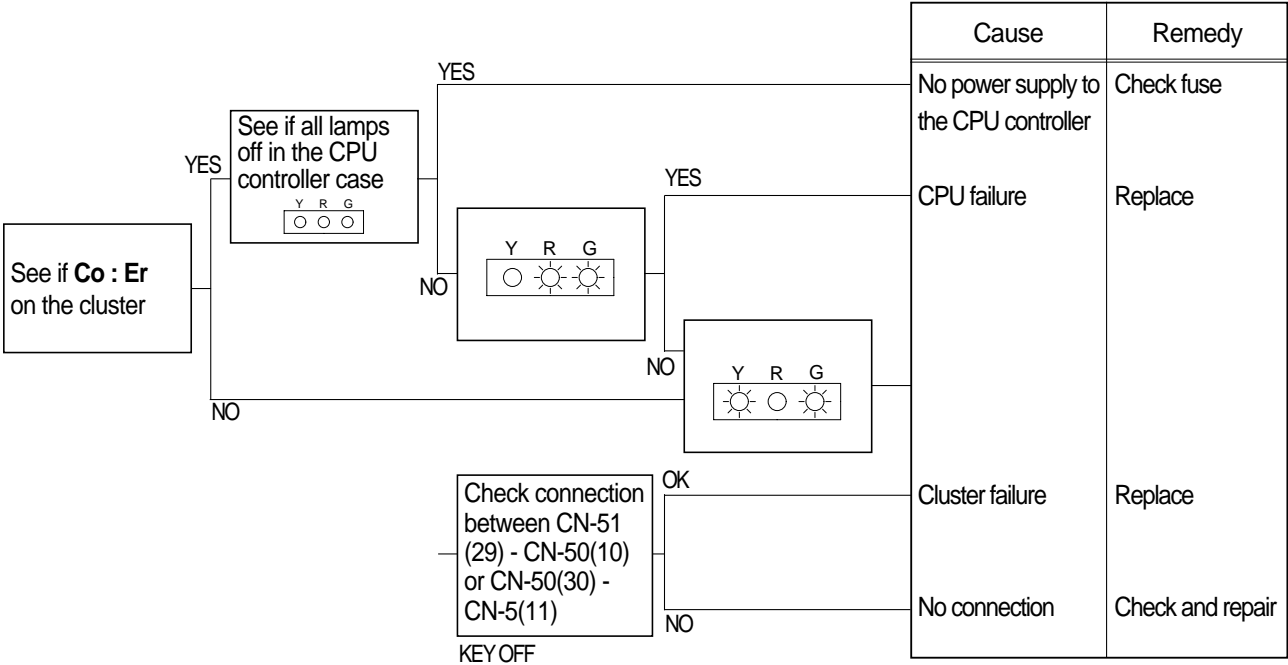


Wiring diagram

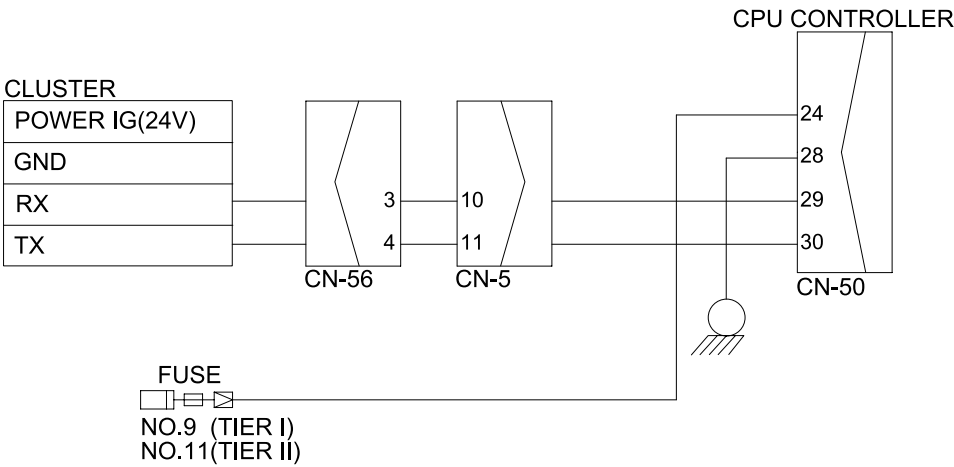


5. SLOW ACTION OF ENGINE SPEED CHANGE WHEN CHANGE THE MODE

Before carrying out below procedure, check all the related connectors are properly inserted.

1) INSPECTION PROCEDURE

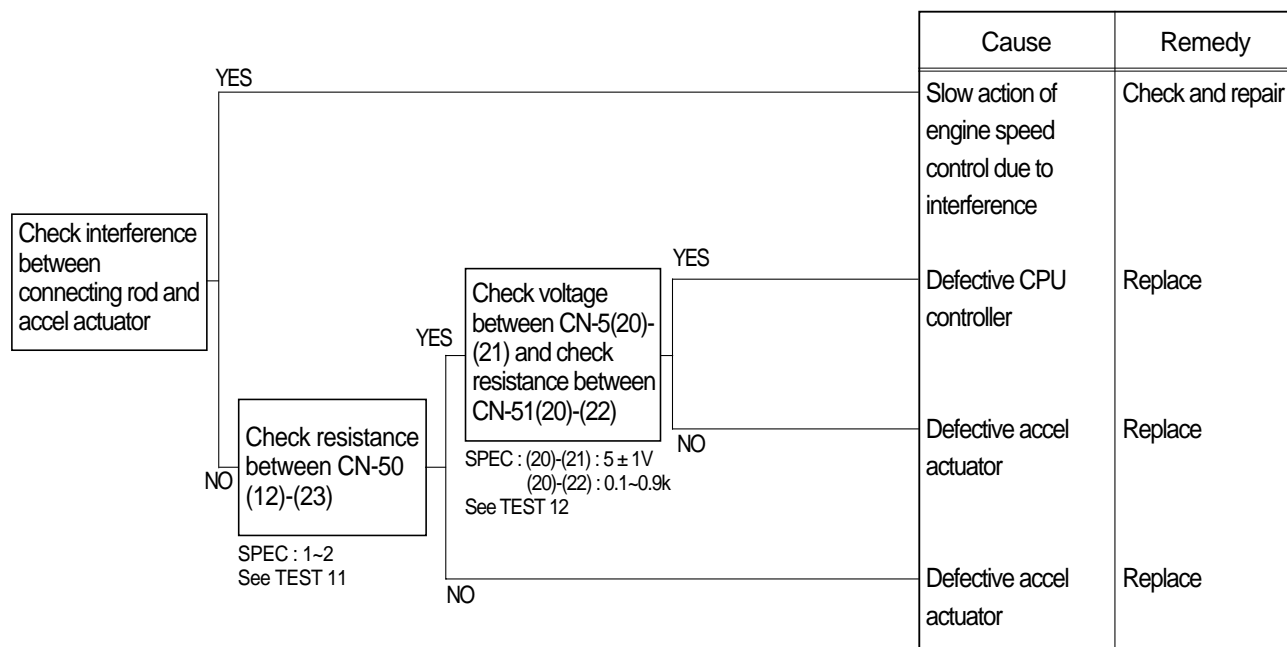

Wiring diagram

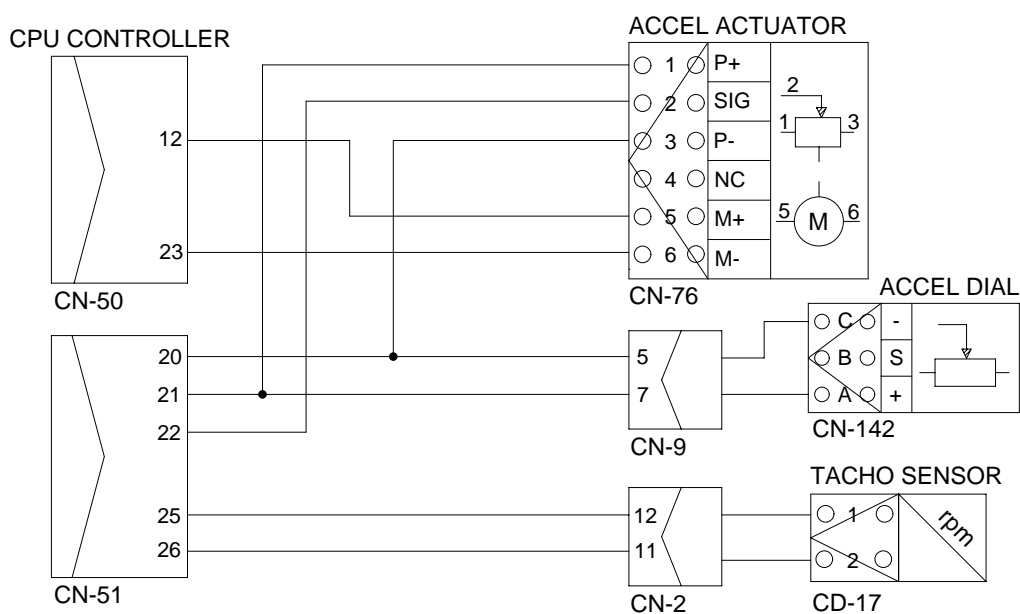

2) TEST PROCEDURE


(1) **Test 11** : Check resistance.

Starting key OFF.


Disconnect connector CN-50 from CPU controller.

Check resistance between CN-50(12)-(23) as figure.

SPEC : 1~2

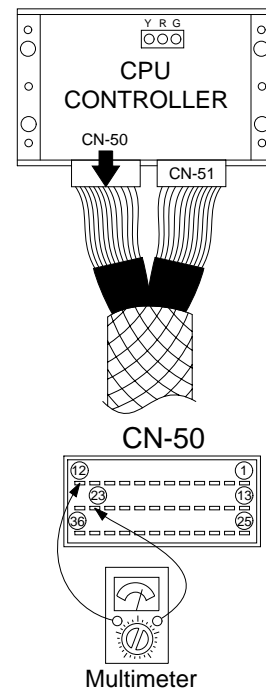


- (2) **Test 12** : Check voltage and resistance.
Check resistance between CN-51(20)-
(22).
- Starting key OFF.
 - Disconnect connector CN-51 from CPU controller.
 - Check resistance value with multimeter as figure.

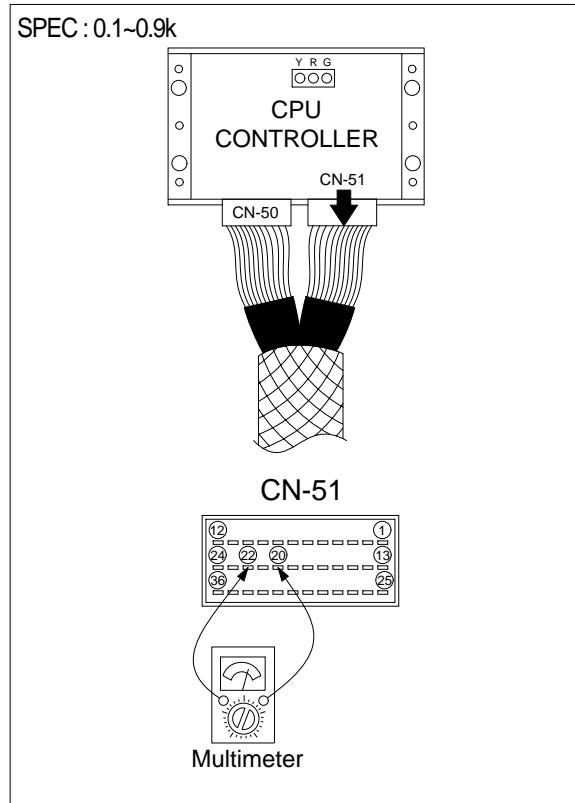

Check voltage between CN-51(20) and
CN-51(21).

- Prepare 2 pieces of thin sharp pin, steel or copper.
- Starting key ON.
- Insert prepared pins to rear side of connectors : One pin to CN-51(20)
Other pin to CN-51(21)
- Check voltage.

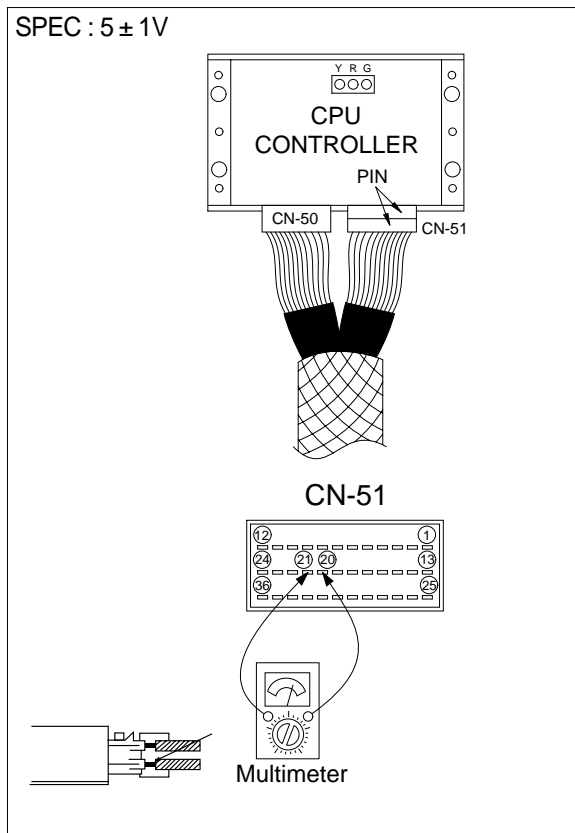


6. AUTO DECEL SYSTEM DOES NOT WORK

Before carrying out below procedure, check all the related connectors are properly inserted.

1) INSPECTION PROCEDURE

		Cause	Remedy
<div>Check resistance between CN-51 (1)-GND and CN-51(13)-GND</div> <div> SPEC : Actuator operating : 11~13V Actuator stop : 0~2V See TEST 13 See TEST 14 </div>	YES	Defective CPU controller	Replace
	NO	Short circuit or poor connection between CN-51(1), (13)- pressure switches	Replace or repair
	NO	Defective auto decel pressure switch	Replace

Wiring diagram

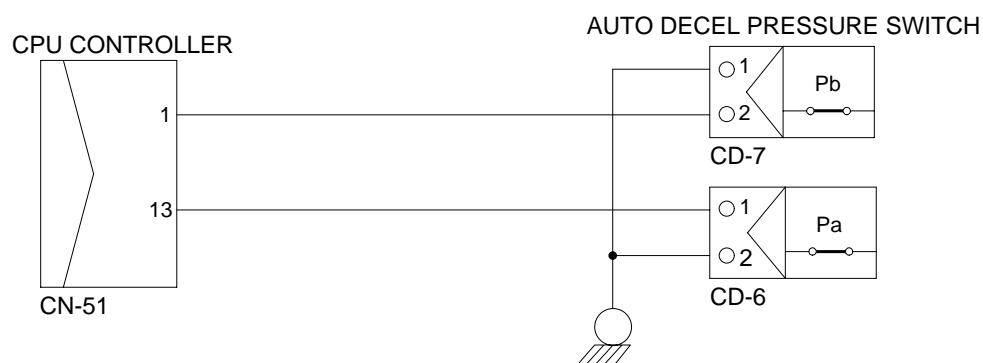

2) TEST PROCEDURE

- (1) **Test 13** : Check voltage at CN-51(1) and ground.

Prepare 1 piece of thin sharp pin, steel or copper.

Starting key ON.

Insert prepared pin to rear side of connectors : One pin to (1) of CN-51.

Check voltage as figure.

- (2) **Test 14** : Check voltage at CN-51(13) and ground.


Prepare 1 piece of thin sharp pin, steel or copper

Starting key ON.

Insert prepared pin to rear side of connectors : One pin to (13) of CN-51

Check voltage as figure.


SPEC : Actuator stop : 11~13V
Actuator operating : 0~2V

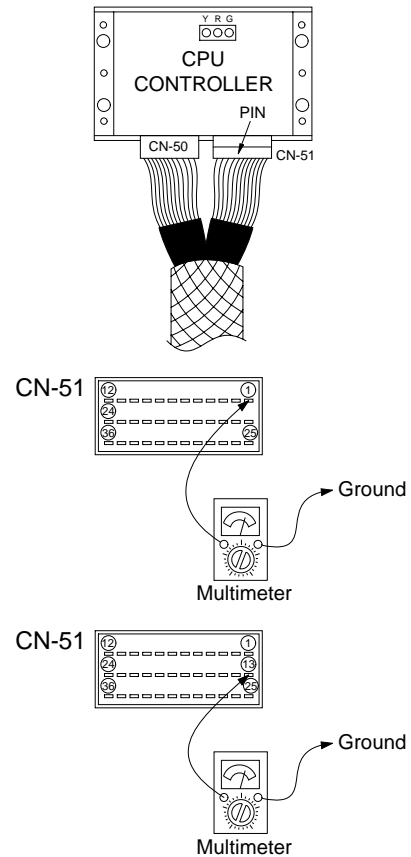


7. MALFUNCTION OF WARMING UP

Before carrying out below procedure, check all the related connectors are properly inserted.

1) INSPECTION PROCEDURE

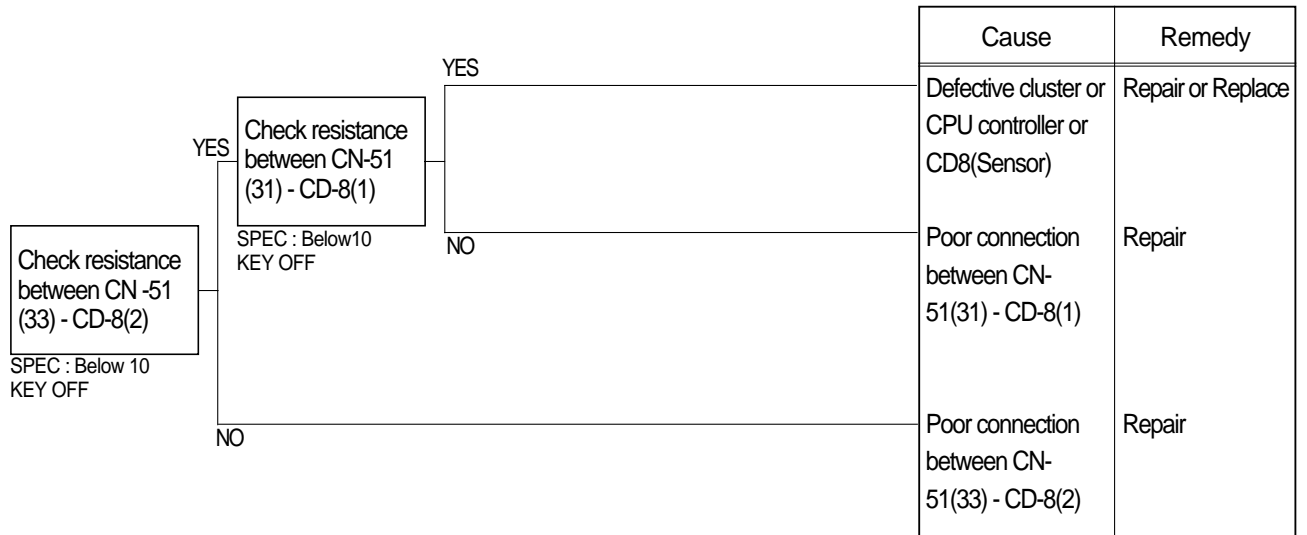


Wiring diagram

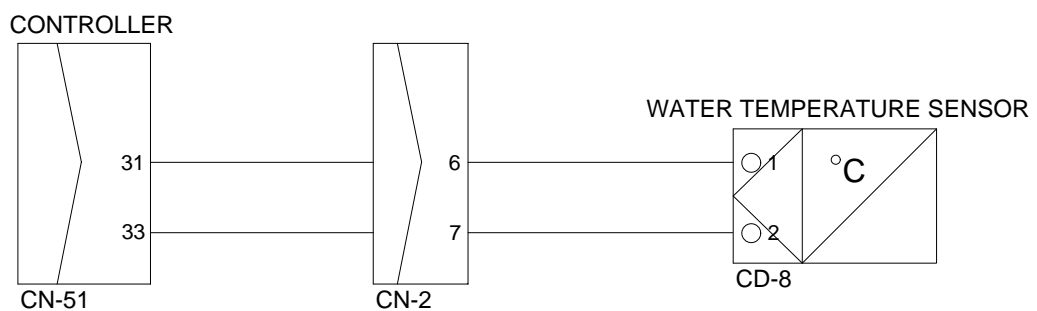


8. MALFUNCTION OF POWER MAX

Before carrying out below procedure, check all the related connectors are properly inserted.

1) INSPECTION PROCEDURE

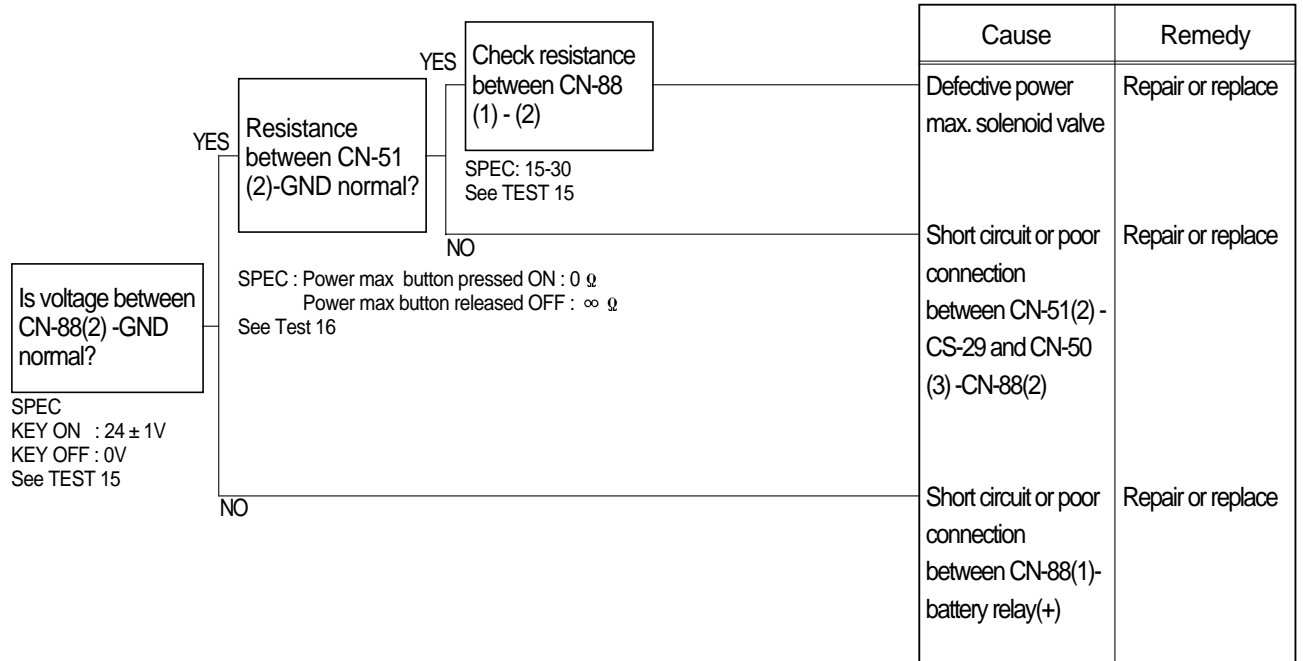

Wiring diagram

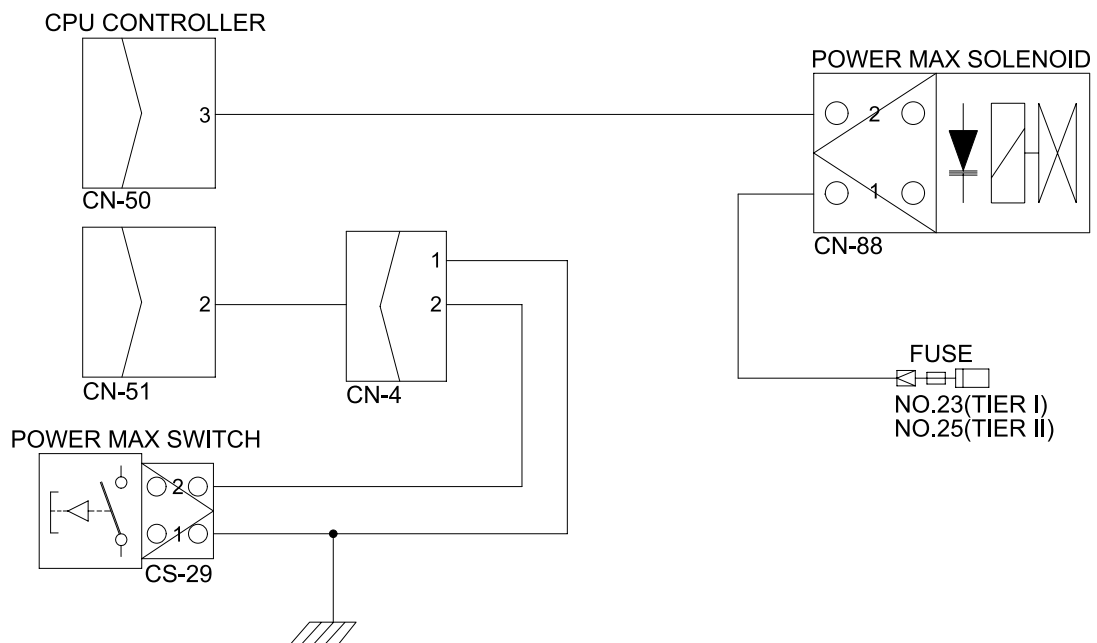

2) TEST PROCEDURE


- (1) **Test 15:** Check voltage between connector CN-88 - GND.

Start key ON.

Disconnect connector CN-88 from power max solenoid valve.

Check voltage as figure.

SPEC : Key ON : $24 \pm 1V$
Key OFF : 0V
Resistance : 15~30

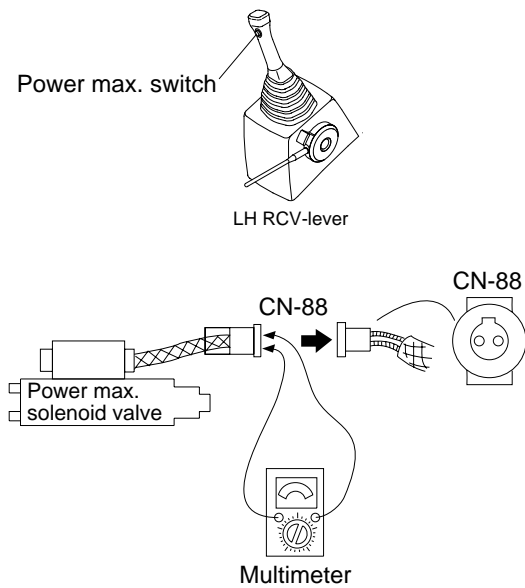

- (2) **Test 16:** Check resistance between connector CN-51(2)-GND.

Starting key OFF.

Remove CPU controller and disconnect connector CN-51 from CPU controller.

Check resistance as figure.

SPEC : Power max button pressed ON : 0
Power max button released OFF :

